



# Technical Memo

Approved by	Checked by	Drawn by
		

**Subject.**

B-Chassis Combination of WLAN Module and CABINET ASSY, UPPER.

**Description.**


In B-Chassis, There is combination of WLAN Module and CABINET ASSY, UPPER.  
 Please keep the combination in repair.

1. When you exchange EDM-020 COMPL ASSY(S) or CABINET ASSY, UP (S), you should keep this combination.
2. When you repair MCB, you should keep this combination.


Model	Factory	Material Code		CABINET ASSY, UP (S)
CAU-1115A 01X	SKZ	27-4189-49	1-008-770-** Vendor : FOX (Freeza)	<b>A-5037-796-A</b>
CAU-1115A 01X	FOXCONN	27-4189-50		<b>A-5037-799-A</b>
CAU-1115A 01X	Goertek	27-4189-79		<b>A-5037-814-A</b>
CAU-1115B 01X	FOXCONN	27-4189-54		<b>A-5037-805-A</b>
CAU-1115B 01X	Goertek	27-4189-90		<b>A-5037-775-A</b>
CAU-1115A 01X	SKZ	27-4189-49	1-012-221-** Vendor : Azurewave (Almeida)	<b>A-5037-797-A</b>
CAU-1115A 01X	FOXCONN	27-4189-50		<b>A-5037-800-A</b>
CAU-1115A 01X	Goertek	27-4189-79		<b>A-5037-815-A</b>
CAU-1115B 01X	FOXCONN	27-4189-54		<b>A-5037-806-A</b>
CAU-1115B 01X	Goertek	27-4189-90		<b>A-5037-776-A</b>

This combination should be keep.

Reference: difference of WLAN Module

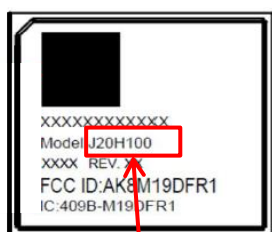

**J20H100**  
 (1-008-770-\*\*)

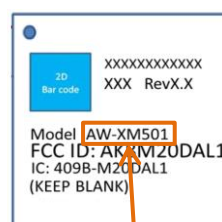

**AW-XM501**  
 (1-012-221-\*\*)

S/C	P/N	Ref No.	Description
S	A-5037-779-A	9105	EDM-020 COMPL(E-F/O)ASSY(S)
S	A-5037-780-A	9105	EDM-020 COMPL(E-A/O)ASSY(S)
S	A-5037-781-A	9105	EDM-020 COMPL(D-F/O)ASSY(S)
S	A-5037-782-A	9105	EDM-020 COMPL(D-A/O)ASSY(S)